




APPLIED ENGINEERING PRODUCTS


(203) 776-2813 FAX (203) 776-8294

www.aep.us


Assembly Instructions

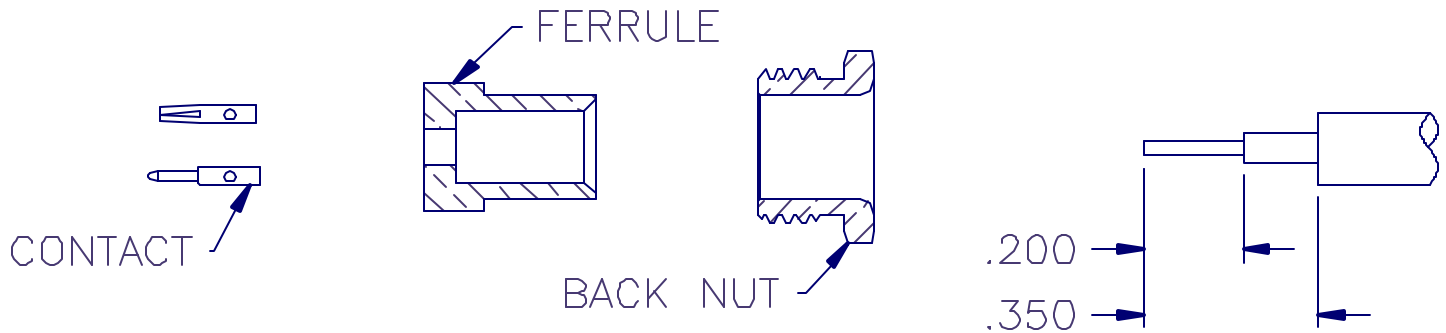

1. TRIM CABLE AS SHOWN.
2. SLIDE BACK NUT ONTO CABLE.

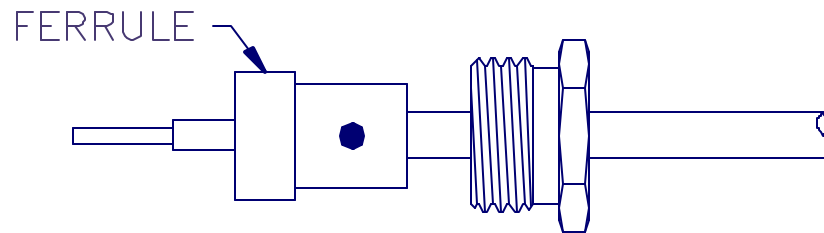

3. SLIDE FERRULE OVER CABLE DIELECTRIC UNTIL IT BOTTOMS ON THE CABLE JACKET.
4. SOLDER FERRULE TO CABLE JACKET. DO NOT DISTURB SOLDER JOINT UNTIL IT HAS COOLED.

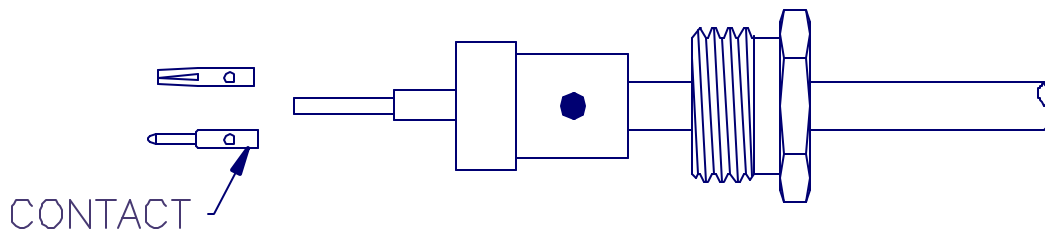

5. SOLDER CONTACT TO CENTER CONDUCTOR. CONTACT TO BE SEATED FLUSH AGAINST DIELECTRIC.
6. INSERT CABLE ASSEMBLY INTO CONNECTOR BODY AND TIGHTEN BACK NUT WITH A TORQUE OF 70-100 INCH OUNCES.

AIS-308-B115 REV. -