


Series
NSX


SIZE 1 COAXIAL CONTACT - WIRING INSTRUCTIONS
FOR E-0406WD CABLE

Issue:
Apr. 22, 16


Page
1 / 1

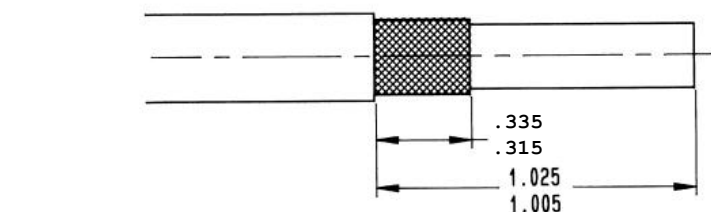

STEP 1
STRIP CABLE JACKET TO DIMENSIONS SHOWN

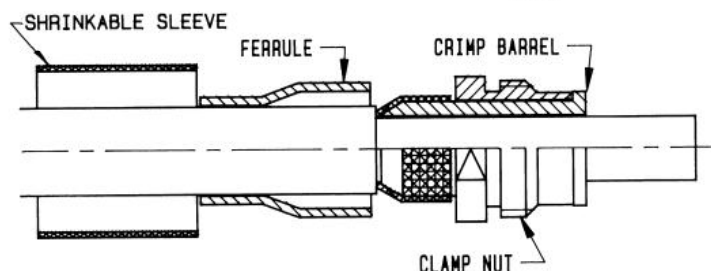


STEP 2
SLIDE FERRULE AND THE SHRINKABLE SLEEVE OVER THE CABLE
FLARE BRAID
SLIDE CRIMP BARREL FITTED WITH CLAMP NUT OVER
DIELECTRIC AND PLACE BRAID ON KNURLED AREA

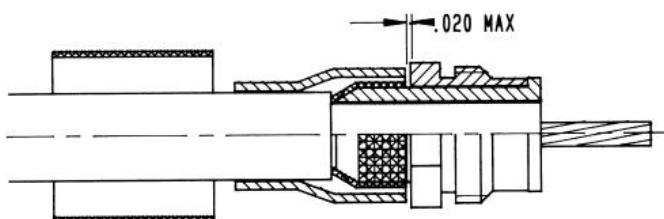


STEP 3
SLIDE FERRULE OVER BRAID MAINTAINING A GAP BETWEEN
FERRULE AND CLAMP NUT. CRIMP FERRULE USING:
CRIMPING TOOL M22520/5-01 (RADIAL 282293)
DIE M22520/5-61 (RADIAL 282247)

BE SURE THAT CLAMP NUT REMAINS TO ROTATE
THEN TRIM DIELECTRIC

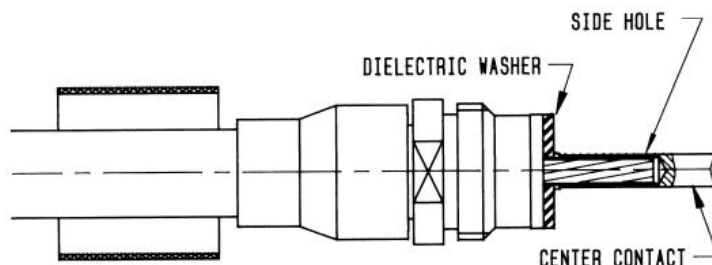

STEP 4
SLIDE DIELECTRIC WASHER OVER CENTER CONDUCTOR
THEN CENTER CONTACT. CRIMP CENTER CONTACT USING:
CRIMPING TOOL M22520/1-01 (RADIAL 282291)
SELECTOR 8
POSITIONER M22520/1-13 (RADIAL 282997) GREEN

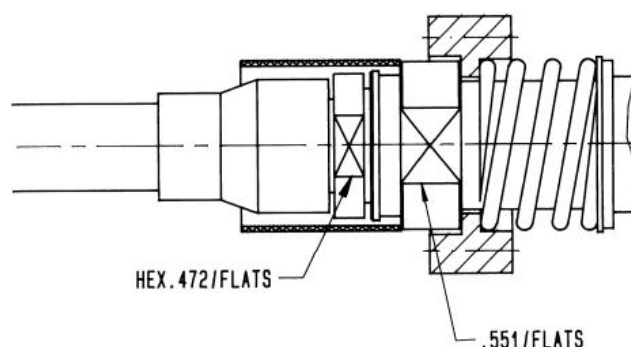

STEP 5
INTRODUCE THE CABLE INTO THE OUTER CONTACT
SCREW AND TIGHTEN THE CLAMP NUT WITH
32 IN-LBS TORQUE

SLIDE THE SHRINKABLE SLEEVE AGAINST
THE CONTACT SHOULDER THEN SHRINK

This information is given as an indication. In the continual goal to improve our products, we reserve the right to make any modifications judged necessary.

4112_9311

CREATION					
PEN:					
NOM: BALDYROU					
DATE: 8 FEB.95					
APPR. VALGRESY					
Apr.22,16	Add tolerances dimensions		Branjonneau	Legendre	
Issue	Revisions		Name	Approved	

RP2799A